

No.: SB-SC-109

DATE: 2024-10-22

**PAGE:** 1/4

## SERVICE BULLETIN

Czech Aircraft Group s.r.o. Na Záhonech 212 686 04 Kunovice Czech Republic info@cruiseraircraft.cz **REV.:** 1

DATE: 01.112024

MODEL AFFECTED:	SportCruiser / PiperSport operating outside EASA rules
SUBJECT:	Checking the bolts in front landing leg
AIRCRAFT AFFECTED:	All Sport Cruicer / DiperSport operating outside EASA rules
COMPLIANCE:	500 or more landings Basic check: Within next 5 FH and then after every 100 FH or API Detail inspection: 100 FH or API (one time action)

#### **DESCRIPTION:**

This Service Bulletin contain instructions how to check and alternatively replace bolts in front landing leg.

#### **AUTHORISATION TO PERFORM:**

Repairman (LS-M) or Mechanic (A&P)

#### MANPOWER:

1 hour (basic check) 3 hours (detail inspection)

#### SPECIAL TOOLS:

Common tools for aircraft maintenance, torque wrench.

#### WEIGHT AND BALANCE:

N/A

ELECTRICAL LOAD DATA:

N/A

PUBLICATIONS AFFECTED:

N/A

#### MATERIAL AND COSTS:

All costs to be covered by the aircraft owner / operator.



No.: SB-SC-109

DATE: 2024-10-22

**PAGE:** 2/4

### SERVICE BULLETIN

Czech Aircraft Group s.r.o. Na Záhonech 212 686 04 Kunovice Czech Republic info@cruiseraircraft.cz **REV.:** 1

DATE: 01.112024

#### LIST OF REVISION:

REV.	REVISION NAME / NOTES	ISSUE DATE
-	Initial issue	2024-10-22
1	Added standards for fasteners description	2024-11-01
2	-	-

NOTE: Order material only if a bolts are damaged.

CAUTION: THE LOOSE SCREWS MUST NOT BE TIGHTENED BUT MUST BE REPLACED. THESE BOLTS ARE ELONGATED AND DAMAGED.

#### **MATERIAL:**

ITEM No	NOMENCLATURE	DESCRIPTION	QUANTITY
001	3111M467	Bolt AN174-12A	6 pcs
002	3121B654	Nut AN365-428	6 pcs
003	3131A418	Washer AN960-416L	6 pcs

#### **BASIC CHECK - ACCOMPLISHMENT INSTRUCTIONS:**

- 1) Move the aircraft to a place suitable to perform the work.
- 2) Remove the wheel fairing and front wheel from front landing leg.
- NOTE: Is not necessary to remove the bolts. If bolts are removed, fresh nuts and washers (item 002, 003) must have to be used.
  - 3) Check all 6 bolts on the nose leg fork (see Fig. 1). Check especially:
    - a) Loosen nuts.
    - b) Missing bolts.
    - c) Play in bolted fork joint.
  - 4) Perform detail inspection and repair in case of any findings.
  - 5) Restore the aircraft to airworthy condition in case of no findings.
  - 6) Update aircraft records to reflect compliance with this Service Bulletin.

#### **DETAIL INSPECTION AND REPAIR - ACCOMPLISHMENT INSTRUCTIONS:**

- 1) Move the aircraft to a place suitable to perform the work.
- 2) Remove the wheel fairing and front wheel from front landing leg.
- 3) Check all 6 bolts on the nose leg fork (see Fig. 1).
- 4) Bolts have to be removed and visually inspected. Check especially:
  - a) Cracks.
  - b) Threat deformation.
  - c) Bolt deformation (bend or elongation).

CRUISER <sup>®</sup> AIRCRAFT	SERVICE BUILLETIN	Czech Aircraft Group s.r.o. Na Záhonech 212 686 04 Kunovice Czech Republic
No.: SB-SC-109		info@cruiseraircraft.cz
DATE: 2024-10-22		<b>REV.:</b> 1
<b>PAGE:</b> 3/4		<b>DATE:</b> 01.112024

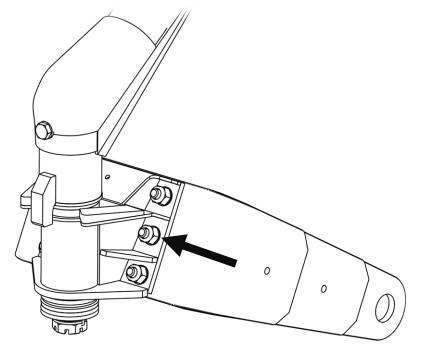


Fig. 1: Front landing leg

- 5) Replace all bolts, nuts and washers (6pcs).
- 6) Use fresh nuts and washers (item 002 and 003) for assembly. Tighten the new bolts to the prescribed torque of 8 Nm.
- 7) Fill and send Aircraft Failure Card (AFC) to <u>info@cruiseraircraft.cz</u> in case of any finding. Attach photos of damaged bolts (whole bolts, detail of damage and symbols on bolt head).
- 8) Restore the aircraft to airworthy condition.
- 9) Update aircraft records to reflect compliance with this Service Bulletin.

#### APPROVAL:

This Service Bulletin has been approved by:

TITLE:	Head of Design Organisation	Airworthiness Manager
NAME:	David Bilík	Roman Švestka
HAND WRITTEN SIGNATURE:	Bilik	2

4	CRUISER
No.:	SB-SC-109
DATE:	2024-10-22
PAGE:	4/4

# **SERVICE BULLETIN**

Czech Aircraft Group s.r.o. Na Záhonech 212 686 04 Kunovice Czech Republic info@cruiseraircraft.cz **REV.:** 1

**DATE:** 01.112024

#### INTENTIONALLY LEFT BLANK